

FIRE SAFETY INSPECTION REPORT

NEWAGE GARMENTS LTD.

**NISCHINTOPUR, PURBO NARSINGHAPUR, ASHULIA,
SAVAR DHAKA.**

OTHER FACTORIES: KEI LOCK NEWAGE (BD) LTD.



April 17, 2014

SUMMARY

Newage Garments Ltd. was surveyed for fire safety on 4/17/2014 by Hughes Associates, Inc. This summary identifies the major deficiencies that were identified during the inspection.

The purpose of this survey was to identify significant fire safety issues and to provide recommendations for remediation based on applicable standards specified by the Accord. The scope of this initial fire safety inspection was limited to the review and identification of major fire safety issues. The inspection did not include identification of minor deficiencies, which will be further addressed as part of follow-up inspections.

Table 1 summarizes the major fire safety issues identified during the inspection. Recommendations have been provided to address each issue.

An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design / installation constraints, shall be submitted to the Accord for approval.

Table 1. Findings And Recommendations

No.	Category	Finding	Recommendation	Remediation Timeframe
F-1	Fire Rated Construction	The exit stairs are not separated from work areas, other spaces on each floor by fire-rated construction.	Provide minimum 1.5-hr fire rated doors and seal all unprotected openings to separate the exit stairs from work areas and other building spaces on all floor levels. Ensure that the fire doors are self-closing and positive latching and that they are provided with fire exit (panic) hardware where serving production floors. If fire doors are required to be held open for functional reasons, provide automatic-closing devices tied to the fire alarm system.	Within 3 months




F-2	Fire Rated Construction	Unsealed penetrations and openings are located in exit stair enclosures.	Seal all penetrations and openings in exit stair enclosure walls to maintain the fire separation.	Within 3 months
-----	-------------------------	--	---	-----------------



F-3	Egress	Egress doors and gates with locking features are provided at building exits and exit stairs.	Remove locking features from all egress doors and gates. If locks are required for security reasons, utilize special door locking features complying with NFPA 101.	Immediate
-----	--------	--	--	-----------



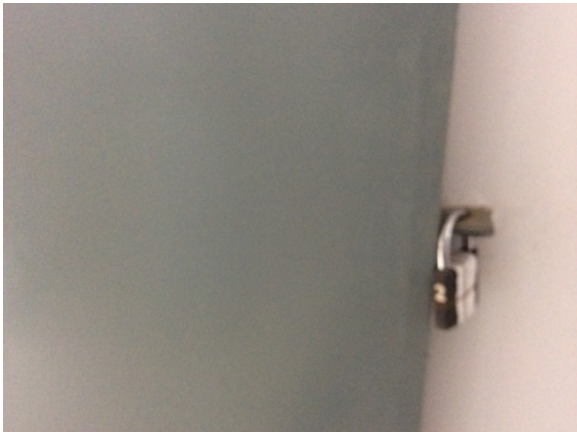

F-4	Egress	Storage was located on the ground floor of north eastern stair and north western stair.	Remove all storage from exit stairs and egress paths.	Immediate
-----	--------	---	---	-----------




F-5	Egress	Collapsible gates and sliding doors are provided at building exits and exit stairs.	Replace all gates and sliding doors along the means of egress with side-hinged, swinging egress doors.	Within 1 month
-----	--------	---	--	----------------

If locks are required for security reasons, utilize special door locking features complying with NFPA 101.



F-6	Fire Protection	The fire alarm system is conventional, not a listed system, and does not provide alarm and notification features consistent with acceptable standards.	Replace the fire alarm system with a new, listed addressable fire alarm system in accordance with NFPA 72.	Design within 4 months, install within 9 months
-----	-----------------	--	--	---

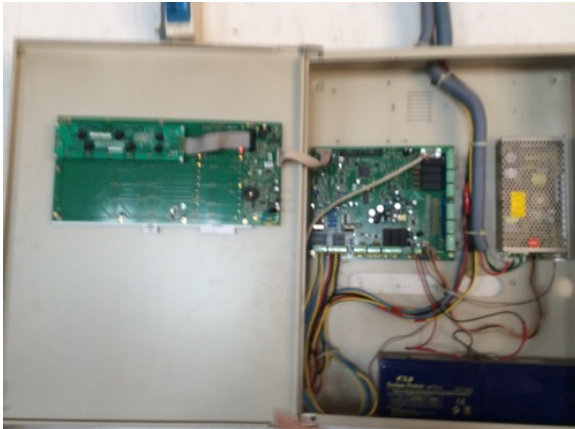

F-7	Fire Protection	Inspection, testing, and maintenance records for the fire alarm system were not available.	Inspect, test and maintain the fire alarm system, and keep written records on-site, in accordance with NFPA 72.	Within 3 months
F-8	Egress Lighting	In multiple locations exit signs were not provided at exits.	Provide exit signs above all exits to the exterior and all doors to the exit stairs.	Within 1 month

