

FIRE SAFETY INSPECTION REPORT

FOUR BROTHERS FASHION DHAKA UDDAN, BERIBADH, MOHAMMAD PUR, DHAKA

OTHER FACTORIES: NONE



ACCORD
on Fire and Building Safety in Bangladesh

March 12, 2014

SUMMARY

Four Brothers Fashion was surveyed for fire safety on 3/12/2014 by Hughes Associates, Inc. This summary identifies the major deficiencies that were identified during the inspection.

The purpose of this survey was to identify significant fire safety issues and to provide recommendations for remediation based on applicable standards specified by the Accord. The scope of this initial fire safety inspection was limited to the review and identification of major fire safety issues. The inspection did not include identification of minor deficiencies, which will be further addressed as part of follow-up inspections.

Table 1 summarizes the major fire safety issues identified during the inspection. Recommendations have been provided to address each issue.

An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design / installation constraints, shall be submitted to the Accord for approval.

Table 1. Findings And Recommendations

No.	Category	Finding	Recommendation	Remediation Timeframe
F-1	Fire Rated Construction	Storage rooms on floors G and 4 and process areas on multiple floors used for combustible storage are not separated by fire-rated construction.	Provide dedicated storage rooms separated by minimum 1-hr fire-rated construction. Where separate storage rooms are not feasible, provide defined storage areas and limit the storage arrangement as follows: - Maximum height of 2.4m and maximum area of 23m² - If sprinkler protected: maximum height of 3.66m and maximum area of 93m² Separate areas of unenclosed combustible storage by a minimum clear distance of 3m.	Within 3 months



F-2	Fire Rated Construction	Both exit stairs are not separated from the factory floor.	Provide minimum 1.5-hr fire rated doors and seal all unprotected openings to separate the exit stairs from work areas and other building spaces on all floor levels. Ensure that the fire doors are self-closing and positive latching and that they are provided with fire exit (panic) hardware where serving production floors.	Within 3 months
-----	-------------------------	--	--	-----------------

If fire doors are required to be held open for functional reasons, provide automatic-closing devices tied to the fire alarm system.



F-3	Fire Rated Construction	The two boiler rooms, two generator rooms, and transformer room are not separated by fire-rated construction.	Separate the service rooms by a minimum 2-hr fire-rated construction. Seal and/or protected all openings to maintain the required fire separations	Within 3 months
-----	-------------------------	---	--	-----------------



F-4	Egress	Storage was located in the front stair at the ground floor.	Remove all storage from exit stairs and egress paths.	Immediate
-----	--------	---	---	-----------



F-5	Egress	Egress doors and gates with locking features are provided at the discharge of both stairs.	Remove locking features from all egress doors and gates. If locks are required for security reasons, utilize special door locking features complying with NFPA 101.	Immediate
-----	--------	--	--	-----------



F-6	Egress	Sliding doors are provided at stairwell discharges.	Replace all gates and sliding doors along the means of egress with side-hinged, swinging egress doors.	Within 1 month
-----	--------	---	--	----------------

If locks are required for security reasons, utilize special door locking features complying with NFPA 101.



F-7	Egress	The width of egress aisles in the storage rooms less than 36-in.	Provide minimum aisle widths of 36-in.	Within 3 months
-----	--------	--	--	-----------------



F-8	Egress	The day-care room does not have direct access to an exit stair.	Relocate day-care room to ground floor with maximum travel distance of 9m (30 ft).	Within 3 months
-----	--------	---	--	-----------------



F-9	Fire Protection	The fire alarm system is antiquated, not a listed system, and does not provide alarm and notification features consistent with acceptable standards.	Replace the fire alarm system with a new, listed addressable fire alarm system in accordance with NFPA 72.	Design within 4 months, install within 9 months
-----	-----------------	--	--	---



F-10	Fire Protection	The high-rise building has an occupied floor greater than 23m (75 ft) and is not provided with automatic sprinkler protection. The large occupant loads, heavy fuel loading, and anticipated extended egress times warrant sprinkler protection.	Provide automatic sprinkler protection throughout the building in accordance with NFPA 13.	Design within 6 months, install within 12 months
F-11	Fire Protection	Inspection, testing, and maintenance for the fire alarm system it was not in accordance with NFPA 72.	Inspect, test and maintain the fire alarm system, and keep written records on-site, in accordance with NFPA 72.	Within 3 months



F-12	Fire Protection	The building is equipped with single-station smoke alarms. Smoke alarm activation sounds only a local alarm and does not provide automatic fire alarm notification of occupants.	Remove single-station smoke alarms. Provide automatic smoke detection throughout the building in accordance with NFPA 72.	Within 6 months
------	-----------------	--	---	-----------------



F-13	Egress Lighting	Inspection, testing, and maintenance records for the emergency lighting system were not available.	Inspect, test and maintain the emergency lighting system in accordance with The ACCORD standard. Keep written records on-site.	Within 3 months
------	-----------------	--	--	-----------------