

FIRE SAFETY INSPECTION REPORT

CHORKA TEXTILE LIMITED (EXTENSION-2)

ACCORD ID: 23867

**Kazirchor, Danga, Palash, Norshingdi
(23.896373, 90.572771)**

OTHER FACTORY (S): NONE



**Inspected By: Md. Anayet Hossain, Safawan Abyaz
Date: 15 October 2019**

Findings & Recommendations :

Following table summarizes the major fire safety issues identified during the inspection. Recommendations have been provided to address each issue. An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design/ installation constraints, shall be submitted to the Accord for approval.

Sl No.	Category	Findings	Required Action	Remediation Time Frame
1	Egress	Sliding doors are provided at exits.	Replace all sliding doors along the means of egress with side-hinged, swinging egress doors. If locks are required for security reasons, utilize specialized door locking features complying with NFPA101.	Within 1 month



2	Egress	Storage were located in several egress paths.	Keep egress path and stair clear of storage	Immediate
---	--------	---	---	-----------



3	Egress	Fire detection system installation requires detailed review to confirm compliance with NFPA 72 and ACCORD standards	Submit as-built drawings, testing records, equipment certification and other relevant documentation to the ACCORD for review and approval	Within 6 months
---	--------	---	---	-----------------



4	Fire Alarm System	The fire alarm system does not appear to provide adequate audible notification coverage.	Provide additional notification appliances such that the fire detection system is audible throughout the building in accordance with NFPA 72.	Within 6 months
5	Fire Protection System (ITM)	Inspection, testing and maintenance (ITM) of the fire detection & alarm system is not in accordance with NFPA 72.	Inspect, test and maintain the fire detection & alarm system and keep written records on-site, in accordance with NFPA 72 and ACCORD standards.	Within 3 months (After complete installation)
6	Egress Lighting	The directional signs are not provided where there is a change in direction and where the continuation of the egress path is not obvious.	Install illuminated directional sign where there is a change in the direction of the path of travel.	Within 1 month

