

INITIAL FIRE SAFETY INSPECTION REPORT

Designer Fashion Ltd. (Warehouse)

RSC ID: 24464

Gohailbari, Shimulia, Ashulia, Savar, Dhaka-1345

Other Factories: None



Inspected By: Pantha Pallob Das

Date: 08 August 2022

Fire Safety Inspection Report

Designer Fashion Ltd. (Warehouse)

Introduction:

Designer Fashion Ltd. (Warehouse) complex was surveyed for fire safety on 08/08/2022 by The RSC Inspection Team. The purpose of the survey was to identify significant fire safety issues and to provide recommendations for remediation based on applicable standards specified by the RSC. The scope of this initial fire safety inspection was limited to the review and identification of major fire safety issues. The inspection did not include identification of minor deficiencies, which will be further addressed as part of follow-up inspections.

Limitations

The information in this fire safety inspection report was obtained during a visit to the facility and during interviews with local factory management. It has not been possible to provide independent verification for all the information and data collected, and, therefore, The RSC cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

General Factory Information

Factory Building name(s): Building -2: Warehouse

Findings & Recommendations :

Table 1 summarizes the major fire safety issues identified during the inspection. Recommendations have been provided to address each issue. An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design / installation constraints, shall be submitted to the RSC for review.

Table-1:

SI No.	Category	Findings	Required Action	Remediation Time Frame
F-1	Fire Rated Construction	The exit stair enclosures are not separated from work areas and other spaces on each floor by fire-rated construction due to non-functionality of fire rated doors and non-rated opening.	The exit stair enclosure shall be provided with a minimum 1-hr fire resistance rating for buildings with 3 or fewer stories and a minimum of 2- hr. fire resistance rating for buildings 4 or more stories. Provide 0.75 hr. fire rated door and seal all penetrations and openings by 1 hr. fire rated fire rated barrier construction for building with 3 or fewer stories. Provide 1.5 hr. fire rated door and seal all penetrations and openings by 2 hr. fire rated fire rated barrier construction for building with 4 or more stories. Provide a fire-resistive rated assembly between the exterior exit stairs and the building up to 10 ft. beyond the end of the stair to achieve the required separation. The rated assembly shall be approved and/or designed by a qualified fire protection engineer. Ensure that the fire doors are self-closing and positive latching and that they are provided with fire exit (panic) hardware where serving production floors. If fire doors are required to be held open for functional reasons, provide automatic closing devices tied to the fire alarm system.	Within 3 months

 				
F-2	Fire Rated Construction	Room used for combustible storage are not separated by fire rated construction on with mezzanine on 1st floor and 1st floor-office part. Mezzanine is occupied as office with 8 individual rooms (inspection rooms).	Provide dedicated storage rooms separated by minimum 1-hr fire-rated construction.	Within 3 months



F-3	Fire Alarm and Detection System (FADS)	The fire alarm system installation requires detailed review to confirm compliance with NFPA 72 and RSC technical guidelines (standard).	Submit as-built drawings, testing records, equipment certification and other relevant documentation to the RSC for review. Once reviewed, install or modify the fire detection and alarm system (where required) throughout the building in accordance with RSC technical guidelines (standard) and NFPA 72. The factory management shall contact RSC to conduct the final acceptance testing after the installation, testing & commissioning.	Within 3 months
F-4	Inspection, Testing and Maintenance of FADS.	Inspection, testing and maintenance for the fire detection and alarm system was not in accordance with standard.	Inspect, test and maintain the fire alarm system and keep written records on-site, in accordance with Table-14.3.1 of NFPA 72.	Within 3 month from today.

F-05	Fire Protection System (SUPS)	The firefighting system (Sprinkler and Standpipe) installation requires detailed review to confirm compliance with NFPA 13,14 and RSC Technical Guideline (Standard).	Submit as-built drawings, testing records, equipment certification and other relevant documentation to the RSC for review. Once reviewed, install or modify the fire detection and alarm system (where required) throughout the building in accordance with RSC technical guidelines (standard) and NFPA 72. The factory management shall contact RSC to conduct the final acceptance testing after the installation, testing & commissioning.	Within 3 months
------	-------------------------------	---	--	-----------------