

FIRE SAFETY INSPECTION REPORT

GENESIS FASHIONS LTD.

ACCORD ID: 12351

**126/1,KADDA NANDUN,KADDA BAZAR,GAZIPUR
SADAR,GAZIPUR,BANGLADESH.**

OTHER FACTORIES: NONE



ACC RD
on Fire and Building Safety in Bangladesh

October 13, 2015

SUMMARY

Genesis Fashions Ltd. was surveyed for fire safety on 10/13/2015 by Jensen Hughes. This summary identifies the major deficiencies that were identified during the inspection.


The purpose of this survey was to identify significant fire safety issues and to provide recommendations for remediation based on applicable standards specified by the Accord. The scope of this initial fire safety inspection was limited to the review and identification of major fire safety issues. The inspection did not include identification of minor deficiencies, which will be further addressed as part of follow-up inspections.

Table 1 summarizes the major fire safety issues identified during the inspection. Recommendations have been provided to address each issue.

An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design / installation constraints, shall be submitted to the Accord for approval.

Table 1. Findings And Recommendations

No.	Category	Finding	Recommendation	Remediation Timeframe
F-1	Fire Rated Construction	Proper certification was not available for fire rated doors installed in the factory.	Submit proper certifications for installed fire doors to the ACCORD for approval. If not available, or certification is not approved, install new, properly certified fire rated doors in accordance with ACCORD direction.	Immediately
				
F-2	Fire Rated Construction	The compressor and EMR room is not separated by fire-rated construction due to non-rated doors and penetrations.	Separate the compressor and EMR room by a minimum 1-hr fire-rated construction for non-high rise. Seal and/or protect all openings to maintain the required fire separations. Provide proper ventilation and consult a qualified engineer.	Within 3 months

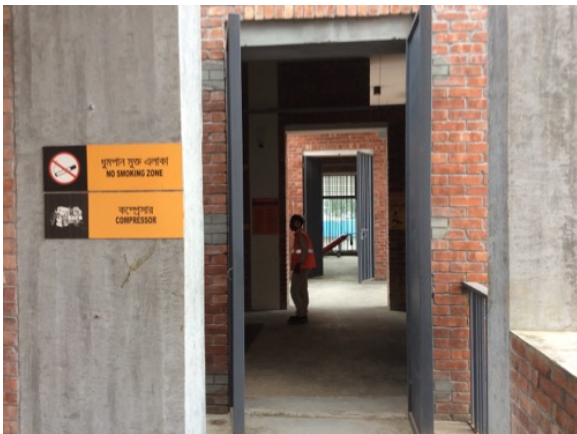

F-3	Fire Rated Construction	Rooms used for combustible storage on the ground floor are not separated by a minimum 1-hr fire-rated construction.	Provide dedicated storage rooms separated by minimum 1-hr fire-rated construction.	Within 3 months
-----	-------------------------	---	--	-----------------



F-4	Fire Rated Construction	North exterior exit stair is not properly separated from the building.	Exterior exit stairs shall be separated from the building with a rating requirement of 1 hr fire rating for 3 or fewer stories. The rating of the exterior wall shall extend 3.05 m (10 ft) beyond the ends of the stair structure.	Within 6 months
-----	-------------------------	--	---	-----------------



F-5	Egress	Fire drills are not performed as required by ACCORD standard.	Fire drills shall be conducted on a quarterly basis in accordance with ACCORD standard 13.2.	Immediately
-----	--------	---	--	-------------

F-6	Fire Protection	Fire alarm system installation requires detailed review to confirm compliance with NFPA 72 and ACCORD standards.	Submit as-built drawings, testing records, equipment certification and other relevant documentation to the ACCORD for review and approval.	Within 1 month
F-7	Fire Protection	Fire pump installation requires detailed review to confirm compliance with NFPA 20 and ACCORD standards.	Submit as-built drawings, testing records, equipment certification and other relevant documentation to the ACCORD for review and approval.	Within 1 month
F-8	Fire Protection	Automatic sprinkler system installation requires detailed review to confirm compliance with NFPA 13 and ACCORD standards.	Submit as-built drawings, testing records, equipment certification and other relevant documentation to the ACCORD for review and approval.	Within 1 month
F-9	Fire Protection	Inspection, testing and maintenance for the fire alarm system is not in accordance with NFPA 72.	Inspect, test and maintain the fire alarm system and keep written records on-site, in accordance with NFPA 72 and ACCORD standards.	Within 3 months
F-10	Fire Protection	Inspection, testing and maintenance of portable fire extinguishers is not in accordance with NFPA 10.	Inspect, test and maintain the portable fire extinguishers and keep written records on-site, in accordance with NFPA 10 and ACCORD standards.	Within 3 months
F-11	Fire Protection	Inspection, testing and maintenance of the fire pump system is not in accordance with NFPA 20.	Inspect, test and maintain the fire pump system and keep written records on-site, in accordance with NFPA 20 and ACCORD standards.	Within 3 months

F-12	Fire Protection	Inspection, testing and maintenance of the automatic sprinkler system is not in accordance with NFPA 25.	Inspect, test and maintain the automatic sprinkler system and keep written records on-site, in accordance with NFPA 25 and ACCORD standards.	Within 3 months
F-13	Fire Protection	Inspection, testing and maintenance of the standpipe system is not in accordance with NFPA 14.	Inspect, test and maintain the standpipe system and keep written records on-site, in accordance with NFPA 14 and ACCORD standards.	Within 3 months
F-14	Fire Protection	Standpipe system is required for the building, which has an occupiable floor 10 m (33 ft) or more above grade.	Install a new class III standpipe system in accordance with ACCORD standard 5.4 and NFPA 14. A class I system shall be permitted in buildings protected throughout by an approved automatic sprinkler system.	Within 6 months
F-15	Egress Lighting	Inspection, testing and maintenance for the emergency lighting system was not in accordance with ACCORD standards.	Inspect, test and maintain the emergency lighting system in the accordance with ACCORD standards. Keep written records on-site.	Within 3 months