

FIRE SAFETY INSPECTION REPORT

YAGI BANGLADESH GARMENTS LIMITED

ACCORD ID: 12012

**HP TOWER, 1/1079 NORTH BARRON, ALIA
MADRASHA, ASHULIA, SAVAR, DHAKA-1349.**

OTHER FACTORIES: NONE



ACCORD
on Fire and Building Safety in Bangladesh

November 5, 2015

SUMMARY

YAGI Bangladesh Garments Limited was surveyed for fire safety on 11/5/2015 by Jensen Hughes. This summary identifies the major deficiencies that were identified during the inspection.

The purpose of this survey was to identify significant fire safety issues and to provide recommendations for remediation based on applicable standards specified by the Accord. The scope of this initial fire safety inspection was limited to the review and identification of major fire safety issues. The inspection did not include identification of minor deficiencies, which will be further addressed as part of follow-up inspections.

Table 1 summarizes the major fire safety issues identified during the inspection. Recommendations have been provided to address each issue.

An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design / installation constraints, shall be submitted to the Accord for approval.

Table 1. Findings And Recommendations


No.	Category	Finding	Recommendation	Remediation Timeframe
F-1	Fire Rated Construction	Liquefied or compressed gas cylinders are located within the factory on ground floor.	The storage or use of liquefied or compressed flammable gas cylinders shall be prohibited within the factory building.	Immediately
				
F-2	Fire Rated Construction	The boiler room on ground floor is not separated by fire-rated construction due to openings, non-rated doors and penetrations.	Separate the boiler room by a minimum 2-hr fire rated construction for high rise. Seal and/or protect all openings to maintain the required fire separations. Provide proper ventilation and consult a qualified engineer.	Within 3 months



F-3	Fire Rated Construction	Rooms on the ground, first and sixth floor used for combustible storage are not separated by a minimum 1-hr fire-rated construction.	Provide dedicated storage rooms separated by minimum 1-hr fire-rated construction. Where separate storage rooms are not feasible, provide defined storage areas and limit the storage arrangement as follows: - Maximum height of 2.45m (8 ft) and maximum area of 23m² (250 ft²) - If sprinkler protected: maximum height of 3.66m (12 ft) and maximum area of 93m² (1000 ft²) Separate areas of unenclosed combustible storage by a minimum clear distance of 3m (10ft).	Within 3 months
-----	-------------------------	--	--	-----------------



F-5	Egress	Each exit stairs serve more than 5 stories and do not have required re-entry provisions.	Every door in a stair enclosure serving more than 5 stories shall be provided with re-entry unless it meets ACCORD standard 6.8.3.1.	Within 3 months
F-6	Egress	Handrails are not provided on both sides of all exit stairs.	Provide handrails on both sides of the exit stair. New handrails shall have a minimum height of 865 mm (34 in.) and a maximum height of 965 mm (38 in.) as measured from the leading edge of the tread. Intermediate handrails shall be provided when the stair width exceeds 2.2 m (87 in.) .	Within 3 months

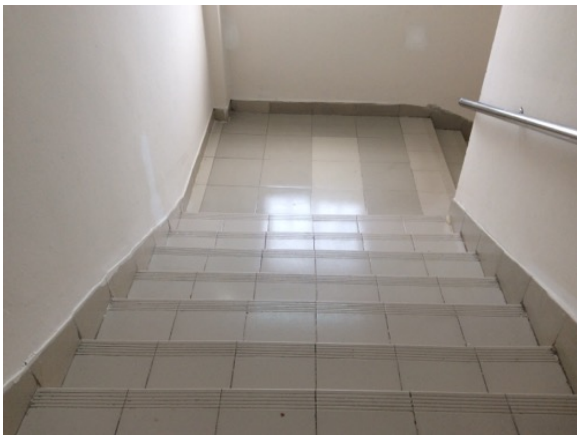

F-7	Fire Protection	Fire alarm system installation requires detailed review to confirm compliance with NFPA 72 and ACCORD standards.	Submit as-built drawings, testing records, equipment certification and other relevant documentation to the ACCORD for review and approval.	Within 1 month
-----	-----------------	--	--	----------------



F-8	Fire Protection	The required no smoking signs are not present in the factory.	Smoking is prohibited in any garment factory building or separate storage building. Signs shall be posted in Bengali and English at all building entrances. If the factory creates a designated smoking area outside the building, information of these areas will be posted on the signs.	Within 1 months
F-9	Fire Protection	Inspection, testing and maintenance for the fire alarm system is not in accordance with NFPA 72.	Inspect, test and maintain the fire alarm system and keep written records on-site, in accordance with NFPA 72 and ACCORD standards.	Within 3 months
F-10	Fire Protection	Fire department connection is not provided.	Provide fire department connection in accordance with ACCORD standard 5.5.4.	Within 3 months

F-11	Fire Protection	Inspection, testing and maintenance of portable fire extinguishers is not in accordance with NFPA 10.	Inspect, test and maintain the portable fire extinguishers and keep written records on-site, in accordance with NFPA 10 and ACCORD standards.	Within 3 months
F-12	Fire Protection	Inspection, testing and maintenance of the standpipe system is not in accordance with NFPA 14.	Inspect, test and maintain the standpipe system and keep written records on-site, in accordance with NFPA 14 and ACCORD standards.	Within 3 months
				
F-13	Fire Protection	Standpipe system is required for the building, which has an occupiable floor 10 m (33 ft) or more above grade.	Install a new class III standpipe system in accordance with ACCORD standard 5.4 and NFPA 14. A class I system shall be permitted in buildings protected throughout by an approved automatic sprinkler system.	Within 6 months



F-14	Egress Lighting	Inspection, testing and maintenance for the emergency lighting system was not in accordance with ACCORD standards.	Inspect, test and maintain the emergency lighting system in the accordance with ACCORD standards. Keep written records on-site.	Within 3 months
------	-----------------	--	---	-----------------