

# **FIRE SAFETY INSPECTION REPORT**

**KARIM TEXTILES, LTD.  
JOYDEPUR-TANGAIL HIGHWAY**



**ACCORD**  
on Fire and Building Safety in Bangladesh



April 5, 2014

## **SUMMARY**

**Karim Textiles, Ltd. was surveyed for fire safety on 4/5/2014 by Hughes Associates, Inc. This summary identifies the major deficiencies that were identified during the inspection.**



**The purpose of this survey was to identify significant fire safety issues and to provide recommendations for remediation based on applicable standards specified by the Accord. The scope of this initial fire safety inspection was limited to the review and identification of major fire safety issues. The inspection did not include identification of minor deficiencies, which will be further addressed as part of follow-up inspections.**

**Table 1 summarizes the major fire safety issues identified during the inspection. Recommendations have been provided to address each issue.**

**An implementation schedule shall be developed by the factory to remediate each of the findings. The specific timing of improvements, including any requested extensions due to design / installation constraints, shall be submitted to the Accord for approval.**


**Table 1. Findings And Recommendations**

No.	Category	Finding	Recommendation	Remediation Timeframe
F-1	Fire Rated Construction	Unsealed penetrations and openings are located in exit stair enclosures.	Seal all penetrations and openings in exit stair enclosure walls to maintain the fire separation.	Within 3 months

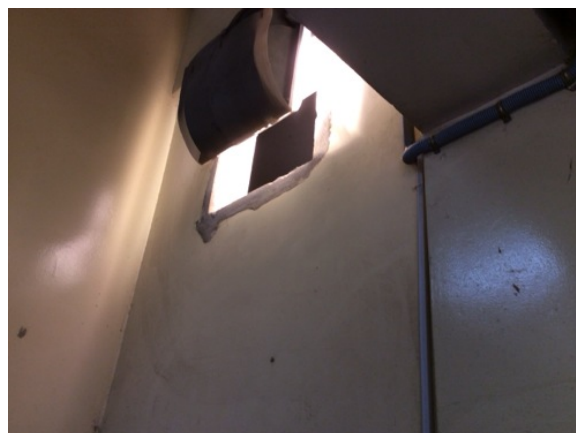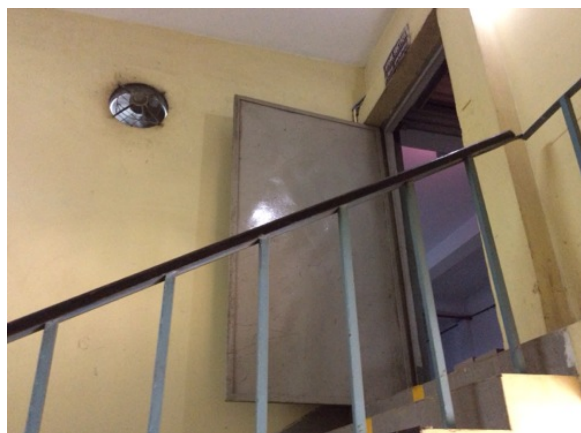

F-2	Fire Rated Construction	The exit stairs are not separated from work areas, and other spaces on each floor by fire-rated construction.	Provide minimum 1.5-hr fire rated doors and seal all unprotected openings to separate the exit stairs from work areas and other building spaces on all floor levels. Ensure that the fire doors are self-closing and positive latching and that they are provided with fire exit (panic) hardware where serving production floors.  If fire doors are required to be held open for functional reasons, provide automatic-closing devices tied to the fire alarm system.	Within 3 months
-----	-------------------------	---	---	-----------------



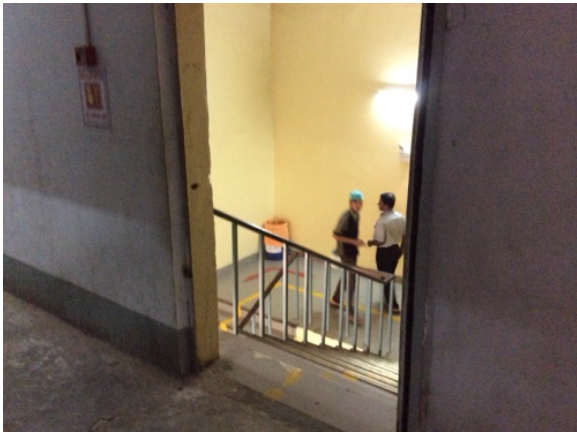

---

F-3	Fire Rated Construction	Areas used for combustible storage are not separated by fire-rated construction.  6th and ground floor store rooms.	Provide dedicated storage rooms separated by minimum 1-hr fire-rated construction.  Where separate storage rooms are not feasible, provide defined storage areas and limit the storage arrangement as follows: - Maximum height of 2.4m and maximum area of 23m <sup>2</sup> - If sprinkler protected: maximum height of 3.66m and maximum area of 93m <sup>2</sup>  Separate areas of unenclosed combustible storage by a minimum clear distance of 3m.	Within 3 months
-----	-------------------------	---	--	-----------------




---

F-4	Egress	Common path of egress travel exceeds 30 m.  6th floor and ground floor store rooms.	Reconfigure the egress arrangement to reduce the maximum common path of travel to not more than 30 m.	Within 3 months
-----	--------	---	---	-----------------



F-5	Egress	Collapsible gates / sliding doors are provided at building exits, and exit stairs.  Sliding gates at many egress stairs.	Replace all gates / sliding doors along the means of egress with side-hinged, swinging egress doors.  If locks are required for security reasons, utilize special door locking features complying with NFPA 101.	Within 3 months
-----	--------	--	--	-----------------

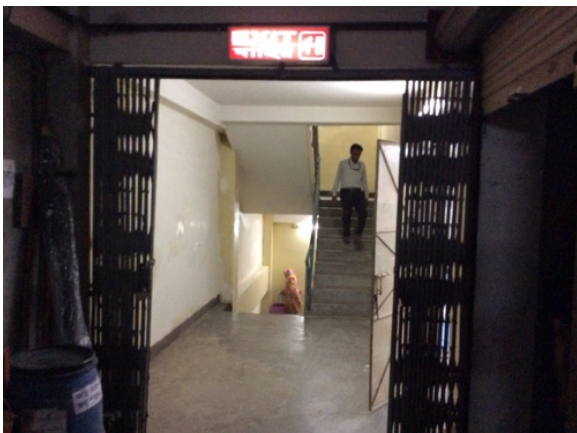

F-6	Egress	<p>Egress doors / gates with locking features are provided at building exits, and exit stairs.</p> <p>Pad locks on doors were unlocked and open at time of inspection.</p>	<p>Remove locking features from all egress doors / gates.</p> <p>If locks are required for security reasons, utilize special door locking features complying with NFPA 101.</p>	<p>Within 3 months</p>
-----	--------	--	---	------------------------



F-7	Fire Protection	<p>The fire alarm system is antiquated, not a listed system, and does not provide alarm and notification features consistent with acceptable standards.</p>	<p>Replace the fire alarm system with a new, listed addressable fire alarm system in accordance with NFPA 72.</p>	<p>Design within 4 months, install within 9 months</p>
-----	-----------------	---	---	--



F-8	Fire Protection	The high-rise building has an occupied floor greater than 23m (75 ft) and is not provided with automatic sprinkler protection. The large occupant loads, heavy fuel loading, and anticipated extended egress times warrant sprinkler protection.	Provide automatic sprinkler protection throughout the building in accordance with NFPA 13.	Design within 6 months, install within 12 months
F-9	Fire Protection	Inspection, testing, and maintenance records for the fire alarm system were not available.	Inspect, test and maintain the fire alarm system, and keep written records on-site, in accordance with NFPA 72.	Within 3 months
F-10	Fire Protection	The fire alarm system does not appear to provide adequate audible notification coverage.  No audible alarm on 10th floor office area.	Provide additional notification appliances such that the fire alarmsystem is audible throughout the building in accordance with NFPA 72.	Within 3 months

---

F-11	Fire Protection	The building is equipped with single-station smoke alarms. Smoke alarm activation sounds only a local alarm and does not provide automatic fire alarm notification of occupants.	Replace the single-station smoke alarms with automatic smoke detectors tied into the fire alarm system. Configure the fire alarm system to initiate occupant notification upon activation of any two smoke detectors in addition to the manual fire alarm stations.	Within 6 months
------	-----------------	--	---	-----------------

